

Work Order ID 119872

\*119872\*

Page 1

May-28-14 9:28:01 AM

Item ID: D412-664-403

Accept

\*N900040100\*

Setup Start

\*NS1\*

Revision ID:

Stop

\*NS2\*

Item Name: Crosstube, Heavy Duty, High Aft, 412

Start Date: 5/28/14

Start Qty: 1.00

\*1\*

Cust Item ID:

Required Date: 6/04/14

Req'd Qty: 1.00

\*1\*

Customer:

Reference:

Approvals:

Process Plan: MJS

Date: 14-05-28

Tooling:

Date:

Run Start

\*NR1\*

QC:

Date:

SPC (Y/N):

Date:

Stop

\*NR2\*

Sequence ID/  
Work Center ID

Operation  
Description

Set Up/  
Run Hours

Tool ID

Tool #

Plan  
Code

Accept  
Qty

Reject  
Qty

Reject  
Number

Insp.  
Stamp

Draw Nbr

Revision Nbr

D412-664-443

A2 A per ECU

MJS 1407-03

100

Document Control

0.00

\*100\*

DOCUMENT CONTROL

DC

Memo

0.00

Doc.Control -USB or Paperwork

Photocopy bluefile & type labels per PPPD412-664-403 CHG001

DAS  
06  
9-89

JUL 03 2014

110

\*110\*

CNC Bend 2

CNC Alpha 160 Bender

BENDING MACHINE - CROSSTUBES

Memo

0.00

Bend tube as per Dwg D412-664-443 using CNC bender program N/A and Folio FT N/A

\*\*\*\*USE (4) DT9824 SHIM BLOC TO CHECK STRAIGHTNESS\*\*\*\*

JW 14-06-23

Pto ->

127

\*127\*

QC

Quality Control

QC15- Crosstube Dimensional Check

0.00

Memo

0.00

\*\*\*MARK CUT LINES\*\*\*

DAS  
16  
9-89 14/06/24

DQA:

Date: 11/07/11

## WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed:

Date: 11-7-7

Work Order update only ☐

Work Order: 119877	<b>DISPOSITION</b>		<b>AGAINST DEPARTMENT/PROCESS</b>			
Part No. D412-664-403	Rework <input type="checkbox"/>	Skid-tube <input type="checkbox"/>	Crosstube <input checked="" type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	
NCR No. A-4012	Scrap <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	
	Use-as-is <input checked="" type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	
	Suspected Unapproved <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>		

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design	11/6/24	110	1	Crushing is over tolerance.	DAS 12 9-89	Acceptable.	DAS 12 9-89	DAS 16 9-89	DAS 16 9-89
Doc/Data						Location of crushing is not critical.			
Equip/Tooling						Ref attached S.R.			
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

## FAULT CATEGORY

<b>Landing Gear</b>	<b>General</b>		
<input checked="" type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Folio/Program	<input type="checkbox"/> Outside Dimensions
<input type="checkbox"/> Centre Not Concentric	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Grain	<input type="checkbox"/> Over/Under tolerance
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damage/Defect	<input type="checkbox"/> Hardware	<input type="checkbox"/> Part Incorrect
<input type="checkbox"/> Crimp/Kink/Ripple/Wave	<input type="checkbox"/> Burrs	<input type="checkbox"/> Inspection Incomplete/Unqualified	<input type="checkbox"/> Part Lost/Missing
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Instructions Incomplete/Unclear	<input type="checkbox"/> Part Moved
<input type="checkbox"/> Crushing	<input type="checkbox"/> Countersink	<input type="checkbox"/> Misaligned/off center	<input type="checkbox"/> Positioned Wrong
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Mislabeled	<input type="checkbox"/> Power Loss/Surge
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Drawing	<input type="checkbox"/> Misread	<input type="checkbox"/> Pressure/Forced
<input type="checkbox"/> Marks/Chatter	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Off-set	<input type="checkbox"/> Set-up
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Calibration	<input type="checkbox"/> Temperature/Cure
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Fit/Function	<input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Weld
			<input type="checkbox"/> Wrong Stock Pulled
			<input type="checkbox"/> Other

Work Order ID: 119872

\*119872\*

Page 2

May-28-14 9:28:01 AM

Item ID: D412-664-403

Accept

\*N900040100\*

Setup Start \*NS1\*

Revision ID:

Stop \*NS2\*

Item Name: Crosstube, Heavy Duty, High Aft, 412

Start Date: 5/28/14 Start Qty: 1.00 \*1\*

Cust Item ID:

Required Date: 6/04/14 Req'd Qty: 1.00 \*1\*

Customer:

Reference:

Approvals: Process Plan: Date: Tooling: Date:

Run Start \*NR1\*

QC: Date: SPC (Y/N): Date:

Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

128

\*128\*

Crosstubes

Crosstubes

Memo

CUT TUBE AT HEIGHT ON FAI SHEET

VERF HEIGHT 24.370 BY QC 15 LEVEL INSPECTOR DAS

VERF TWIST 0.640" BY QC15 LEVEL INSPECTOR 16

DAS

16

9-89

14/6/25

130

\*130\*

Crosstubes

Crosstubes

Crosstubes

Memo

1- Drill Tube as per Dwg D412-664-443 Using DT 4550 KSS Drill Jigs,  
Set-up drill table as per QSI 010

2-Deburr

3- Engrave Part # and Batch # as per Dwg D412-664-443

4-Remove all marks from tube within limits of D412-664-43 DWG.

BSL / DL 14-06-25

BSL 14-06-25

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width:100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

# Work Order ID 119872

May-28-14 9:28:01 AM

**\*119872\***

Page 3

Item ID: D412-664-403

Accept

**\*N900040100\***

Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Crosstube, Heavy Duty, High Aft, 412

Start Date: 5/28/14 Start Qty: 1.00 **\*1\***

Cust Item ID:

Required Date: 6/04/14 Req'd Qty: 1.00 **\*1\***

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_  
QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Run Start **\*NR1\***

Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
140	<del>QC</del> Inspect dimensions to drawing	0.00							
<b>*140*</b>	<i>QC</i>								
QC	Memo	0.00							
Quality Control									
172		0.00							
<b>*172*</b>									
Crosstubes	Memo	0.00							
Crosstubes	***LOAD TEST TO 3000LB FOR 1 MINUTE***								
174	Outsource process - NDT per QSI038 4.1	0.00							
<b>*174*</b>									
Outsource2	Memo	0.00							
Outsource process - NDT	ISSUE P/O TO ACCUREN: <u>24765</u>								

*N/A see attached*

*CL 14/06/26 ①*

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width:100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

Work Order ID 119872

May-28-14 9:28:01 AM

\*119872\*

Page 4

Item ID: D412-664-403

Accept

\*N900040100\*

Setup Start \*NS1\*

Revision ID:

Stop \*NS2\*

Item Name: Crosstube, Heavy Duty, High Aft, 412

Start Date: 5/28/14 Start Qty: 1.00 \*1\*

Cust Item ID:

Required Date: 6/04/14 Req'd Qty: 1.00 \*1\*

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start \*NR1\*

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
176	Receive & Inspect for Damage & Mat'l Certs	0.00							
<b>*176*</b>									
Packaging	Memo	0.00							
Packaging									
178	<del>QC</del> - Inspect part completeness to step on W/O	0.00							
<b>*178*</b>									
QC	<del>QC</del> Memo	0.00							
Quality Control									

1x SQ 14-6-27

DAS  
16  
9-89 14/06/27

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width:100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other  _____ _____ _____
--	--	---	---



**Work Order ID 119872**

May-28-14 9:28:01 AM

**\*119872\***

Page 5

Item ID: D412-664-403

Accept

**\*N900040100\***

Setup Start

**\*NS1\***

Revision ID:

Stop

**\*NS2\***

Item Name: Crosstube, Heavy Duty, High Aft, 412

Start Date: 5/28/14

Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 6/04/14

Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals:

Process Plan: \_\_\_\_\_

Date: \_\_\_\_\_

Tooling: \_\_\_\_\_

Date: \_\_\_\_\_

Run

Start

**\*NR1\***

QC: \_\_\_\_\_

Date: \_\_\_\_\_

SPC (Y/N): \_\_\_\_\_

Date: \_\_\_\_\_

Stop

**\*NR2\***Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run Hours

Tool ID

Tool #

Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

180

0.00

**\*180\***

SprayPaint

0.00

SprayPaint

Memo

1-Prime inside & outside crosstube as per QSI 005 4.2  
BATCH: 1293282- MASK UNDERSIDE OF CROSSTUBE AS SHOWN ON DWG BEFORE  
PAINTING3 -Paint Outside of Tube as per Dart QSI 005 4.2  
BATCH: 129269

4- After painting remove masking and apply matte clear coat per QSI005 4.2

129174

DAS

27

9-89

190

0.00

**\*190\***

QC14- Inspect Spray Paint

0.00

QC

Memo

Quality Control

14-6-27

4/7/13

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width:100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design <input type="checkbox"/>									
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Handling/Pre <input type="checkbox"/>									
Material <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Offset/Setup <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Transport <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other
--	--	---	--

# Work Order ID 119872

May-28-14 9:28:01 AM

**\*119872\***

Page 6

Item ID: D412-664-403 Accept **\*N900040100\*** Setup Start **\*NS1\***  
 Revision ID: Stop **\*NS2\***  
 Item Name: Crosstube, Heavy Duty, High Aft, 412  
 Start Date: 5/28/14 Start Qty: 1.00 **\*1\*** Cust Item ID:  
 Required Date: 6/04/14 Req'd Qty: 1.00 **\*1\*** Customer:  
 Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_ Run Start **\*NR1\***  
 QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_ Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
200	Crosstubes	0.00							
<b>*2000*</b>									
Crosstubes									
Crosstubes	<p><b>Memo</b></p> <p>1- Install center support using scoth-weld DP460 per QSI 015, as per DWG. note 12.</p> <p>A/R scoth-weld DP460 BATCH #: <u>128480</u> <u>exp 15/03</u></p> <p>2- Install clamp with rubber cushion as per DWG. note 13</p> <p>3- Abrade mating surfaces of support and crosstube with 400 grit sandpaper, clean the area with 4105S wash 'n' wipe</p> <p>4- <b>**IF NOT ALREADY PRESENT ON CHAFFING SHEILD.**</b> Apply a thin coat of proseal 890 per QSI 015 on inside concave surface of chafing shield and let cure per manufacturer's instructions. Install prosealed chafing shield onto crosstube by applying a thin coat of proseal 890 onto crosstube. Be sure to eliminate any air gaps.</p> <p>A/R Proseal 890 Batch: <u>128638</u> <u>exp 10/14</u></p> <p>5- Install supports clamps using DT _____ as per Dwg D412-644-443, Torque clamps on support to 80-100 IN-LBS. Torque clamps on chafing shield to 40-50 IN-LBS.</p> <p>START CURE TIME: <u>14-7-1</u> FINISH CURE TIME: <u>14-7-2</u></p> <p>PRIOR TO PACKAGING RE-CHECK TORQUE ON CLAMPS AFTER CURED FOR 24H.</p>	0.00							<u>AS</u> <u>14-7-1</u>

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

**Work Order ID 119872**

May-28-14 9:28:01 AM

**\*119872\***

Page 7

Item ID: D412-664-403

Accept

**\*N900040100\***Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Crosstube, Heavy Duty, High Aft, 412

Start Date: 5/28/14 Start Qty: 1.00 **\*1\***

Cust Item ID:

Required Date: 6/04/14 Req'd Qty: 1.00 **\*1\***

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start **\*NR1\***

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

210

QC5- Inspect part completeness to step on W/O

0.00

**\*210\***

QC

Memo

0.00

Quality Control

PRIOR TO PACKAGING RE-CHECK TORQUE ON CLAMPS AFTER  
CURED FOR 24H.

220

Pick Kit

0.00

**\*220\***

Packaging

Memo

0.00

Packaging

230

QC4- 100% Inspect kits for completeness

0.00

**\*230\***

QC

Memo

0.00

Quality Control

DAS 28 9-89  
JUL 03 2014

DAS 31 9-89

DAS 28 9-89

JUL 03 2014

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>
--	--	---

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

**Work Order ID 119872**

May-28-14 9:28:01 AM

**\*119872\***

Page 8

**Item ID:** D412-664-403**Accept****\*N900040100\*****Setup Start \*NS1\*****Revision ID:****Stop \*NS2\*****Item Name:** Crosstube, Heavy Duty, High Aft, 412**Start Date:** 5/28/14 **Start Qty:** 1.00 **\*1\*****Cust Item ID:****Required Date:** 6/04/14 **Req'd Qty:** 1.00 **\*1\*****Customer:****Reference:****Approvals:** **Process Plan:** \_\_\_\_\_ **Date:** \_\_\_\_\_ **Tooling:** \_\_\_\_\_ **Date:** \_\_\_\_\_**Run Start \*NR1\*****QC:** \_\_\_\_\_ **Date:** \_\_\_\_\_ **SPC (Y/N):** \_\_\_\_\_ **Date:** \_\_\_\_\_**Stop \*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
240	Packaging	0.00							
<b>*240*</b>									
Packaging	<b>Memo</b>	0.00							
Packaging	Identify and pack for shipping as per PPPD412-664-443								
	Location: <u>SHIP</u>								
	PPP Rev: _____								
250	QC21- Final Inspection - Work Order Release	0.00							
<b>*250*</b>									
QC	<b>Memo</b>	0.00							
Quality Control									

MF  
14-7-03

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--



# Picklist Print

May-28-14 9:28:04 AM

Page 1

Work Order ID: 119872

**\*119872\***

Parent Item: D412-664-403

**\*D412-664-403\***

Parent Item Name: Crosstube, Heavy Duty, High Aft, 412

Start Date: 5/28/14

Required Date: 6/04/14

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP REV:A 13.10.25 NEW ISSUE DD VERF:JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D3595-063-530

Manufactured No

Each 220.0000

2

**\*D3595-063-530\***

**\*\***

AB 14-7-1

Rubber Cushion

Location	Loc Qty	Loc Code
FG	5	
82656	5	
FP	6	
111194	6	
LG	2	
110937	2	
LG050	4	
118829	4	
LG051	132	
113291	8	
117571	124	
ST412	71	
113930	71	

D412-664-443TRN

Manufactured No

Each 0.0000

1

**\*D412-664-443TRN\***

**\*\***

Crosstube Turning Detail

D4909-1

Manufactured No

Each 6.0000

1

**\*D4909-1\***

**\*\***

Support

Location	Loc Qty	Loc Code
LG053	6	
109899	3	
109972	3	

AB 14-7-1

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width:100%; border: none;"> <tr> <td style="width:15%;">Skid-tube <input type="checkbox"/></td> <td style="width:15%;">Crosstube <input type="checkbox"/></td> <td style="width:15%;">Water Jet <input type="checkbox"/></td> <td style="width:15%;">Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

# Picklist Print

May-28-14 9:28:04 AM

Page 2

Work Order ID: 119872

**\*119872\***

Parent Item: D412-664-403

**\*D412-664-403\***

Parent Item Name: Crosstube, Heavy Duty, High Aft, 412

Start Date: 5/28/14

Required Date: 6/04/14

Start Qty: 1.00

Required Qty: 1.00

D4910-1

Manufactured No

Each

4.0000

2

**\*D4910-1\***

Chaffing Shield

110160

\*\*

AS 14-7-2

(2)

Location

Loc Qty

Loc Code

LG053

4

109900

2

112341

2

MS21920-26

Purchased

No

Each

100.0000

4

**\*MS21920-26\***

Clamp

\*\*

AS 14-7-2

Location

Loc Qty

Loc Code

LG050

100

107545

31

107974

20

109206

49

MS21920-28

Purchased

No

Each

177.0000

2

**\*MS21920-28\***

Clamp

\*\*

AS 14-7-1

(4)

(2)

Location

Loc Qty

Loc Code

FG

5

105884

5

LG050

168

M128363

1

M128717

4

M128771

69

M128772

19

M129279

75

Return2014

4

128717

4

May-28-14 9:28:04 AM

Shop Packet Print

Page 2

DQA: \_\_\_\_\_ Date: \_\_\_\_\_



## WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order update only ☐

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Suspected Unapproved <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>
--	--	---

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric <input type="checkbox"/> Cracks <input type="checkbox"/> Crimp/Kink/Ripple/Wave <input type="checkbox"/> Cuffs <input type="checkbox"/> Crushing <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Marks/Chatter <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damage/Defect <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drawing <input type="checkbox"/> Drill Holes <input type="checkbox"/> Finish <input type="checkbox"/> Fit/Function	<input type="checkbox"/> Folio/Program <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete/Unqualified <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Misaligned/off center <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Off-set <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Set-up <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
--	--	---	--

119872

32.13.2 HIGH GEAR CROSSTUBE, HEAVY DUTY

ITEM	QTY -403	PART NUMBER	DESCRIPTION
	X	D412-664-403	CROSSTUBE INSTALLATION, HEAVY DUTY, 412 HIGH AFT
9	1	D412-664-443	CROSSTUBE ASSEMBLY, HEAVY DUTY, 412 HIGH AFT
70	1	* D4909-1	SUPPORT
71	2	* D4910-1	CHAFING SHIELD
72	2	* D3595-063-530	RUBBER CUSHION
73	4	* MS21920-26	CLAMP
74	2	* MS21920-28	CLAMP
M128634	4	AN6-40A	BOLT
M128849	2	AN6-41A	BOLT
M128635	6	MS21042L6	NUT (OR MS21042-6)
M128818	18	AN960JD616	WASHER

DAS  
06  
9-89

DAS

31

9-89

DAS

28

9-89

NA5114920663


\*REFERENCE ONLY. PARTS ARE INCLUDED IN D412-664-443 ASSEMBLY ABOVE

NOTE: KITS INCLUDE EXTRA HARDWARE FOR COMPATIBILITY WITH BOTH DART AND BELL/AAI SKIDTUBES.

JUL 03 2014

<b>DART AEROSPACE LTD</b>	<b>Work Order:</b>	119872
<b>Description:</b> 412 Hi Aft cross tube	<b>Part Number:</b>	D412.664-403
<b>Inspection Dwg:</b> D412.664.443 <b>Rev:</b> 17		<b>Page 1 of 1</b>

Required Dimension	Min	Max
Height	24.12	24.62
1/2 Span	53.56	53.82
Angle	49°	52°
Total Span	107.12	107.64
Bending Passes	8	
Crushing	—	7.7%

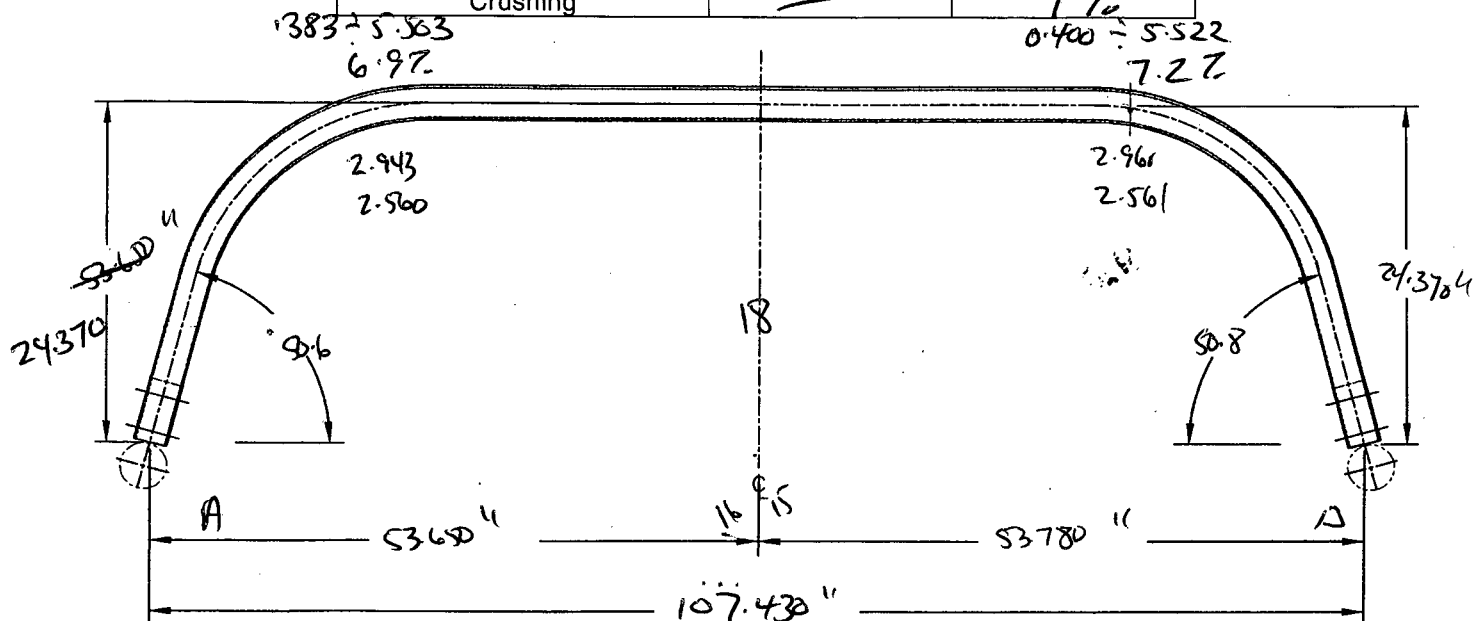

	Side A	Middle	Side B
<b>Bending Passes</b>	16	18	15
<b>Crushing</b>	6.97%		7.27%
<b>Comments</b>			
Side A = 6.97% crush @ 16 Passes.			
Middle = 18 Passes.			
Side B = 7.27% crush @ 15 Passes.			

<b>QC15 Inspection</b>	DAS
<b>Date</b>	16/06/21

Rev	Date	Change	Revised by	Approved
A		New Issue		
B	06.09.19	Reformat; QC level revised	KJ/JM	
C	07.02.06	Reformat	KJ/JM	
D	12.02.15	Added bending passes and crushing	KJ	
E	12.03.07	Revised comments table	KJ	

Item	Qty -443	Part Number	Description
1	X	D412-664-443	CROSSTUBE ASSEMBLY (412 HI AFT)
2	1	D6020-132	CROSSTUBE MATERIAL (132" MIN. LENGTH)
3	2	D3595-063-530	RUBBER CUSHION
4	1	D4909-1	SUPPORT
5	2	D4910-1	CHAFING SHIELD
7	4	MS21920-26	CLAMP
8	2	MS21920-28	CLAMP
9	A/R	SCOTCH-WELD DP460	EPOXY ADHESIVE, 3M SCOTCH-WELD
10	A/R	PROSEAL 890	SEALANT

#### GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6020-132  
FINISHED LENGTH = 130.10±0.060 (BEFORE BENDING/TRIMMING)
- 2) FINISH: PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (ZN C6-2, HATCHED AREA)  
PAINT OUTSIDE PER DART QSI 005 4.2  
AFTER PAINTING, REMOVE MASKING AND APPLY MATTE CLEAR COAT PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART P/N "D412-664-443" AND B/N ON INSIDE OF CUFF PER DART QSI 044 6.4 (VIBRATING STYLUS)
- 7) WEIGHT: 90.2 lb AFTER MACHINING  
86.7 lb FINISHED WEIGHT
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.

#### BENDING

- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 7% (BASED ON O.D.) IN LOWER HALF OF R35 BEND AND 6% (BASED ON O.D.) ON REMAINING TUBE.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038. TO BE PERFORMED AFTER FINAL POST-BEND GRINDING. ANY ADDITIONAL GRINDING REQUIRES ANOTHER LPI INSPECTION.

#### ASSEMBLY


- 12) INSTALL D4909-1 CENTER SUPPORT USING A 0.04" TO 0.07" THICK LAYER OF SCOTCH-WELD DP460 PER QSI 015.
- 13) INSTALL MS21920-28 CLAMPS WITH D3595-063-530 RUBBER CUSHIONS TO SECURE THE D4909-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE ON TOP OF CROSSTUBE SUPPORT.
- 14) IF NOT ALREADY PRESENT ON CHAFING SHIELD, APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D4910-1 CHAFING SHIELD AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL PROSEALED D4910-1 CHAFING SHIELD ONTO CROSSTUBE BY APPLYING A THIN COAT OF PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.
- 15) TORQUE CLAMPS ON D4909-1 SUPPORT 80 TO 100 IN-LB. TORQUE CLAMPS ON D4910-1 CHAFING SHIELD 40 TO 50 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER ADHESIVES HAVE CURED FOR 24 HOURS.

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 119872 MJS  
1405-28


RELEASED  
2014-05-26  
MJS

A	NEW ISSUE	CP	14.04.01
REV.	DESCRIPTION	BY	DATE
DESIGN	90		
DRAWN	90		
CHECKED	90		
MFG. APPR.	90		
APPROVED	90		
DE APPR.	90		
DATE	14.04.01		


DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWING NO. D412-664-443	REV. A SHEET 1 OF 4
TITLE CROSSTUBE ASSY (412 HI AFT)	SCALE NTS
COPYRIGHT © 2013 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

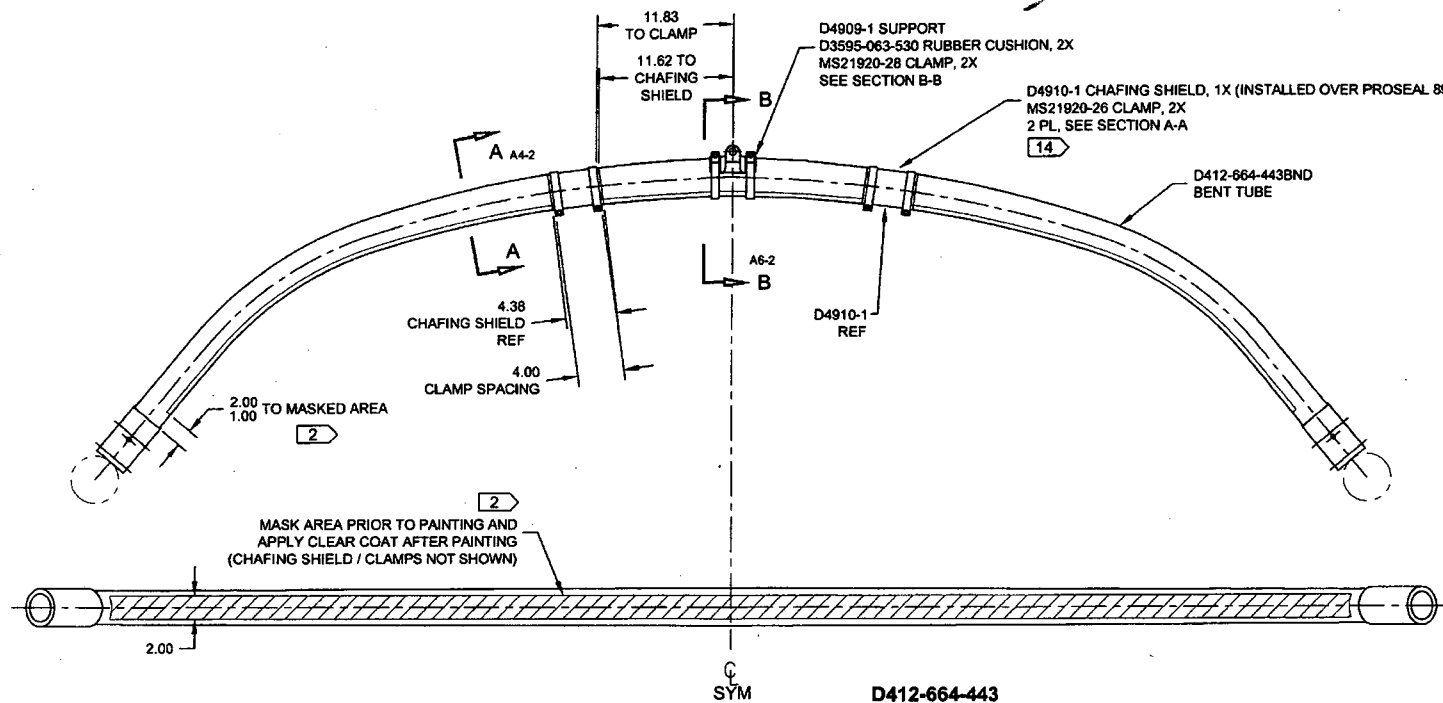

**D412-664-443**  
ASSEMBLY DETAIL

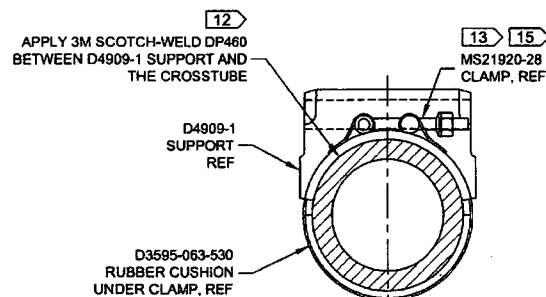

**SECTION B-B** O4-2  
SCALE 4X

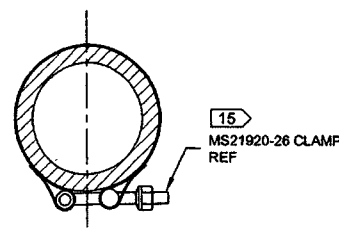


**SECTION A-A** C6-2  
SCALE 4X

**RELEASED**  
2014-05-26  
MP


DESIGN	GP	<b>DART AEROSPACE LTD</b>	
DRAWN	GP	HAWKESBURY, ONTARIO, CANADA	
CHECKED	DW	DRAWING NO.	REV. A
MFG. APPR.	JP	D412-664-443	SHEET 2 OF 4
APPROVED	JP	TITLE	SCALE
DE APPR.	JP	CROSSTUBE ASSY (412 HI AFT)	NTS
DATE	14.04.01	<small>COPYRIGHT © 2013 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD</small>	



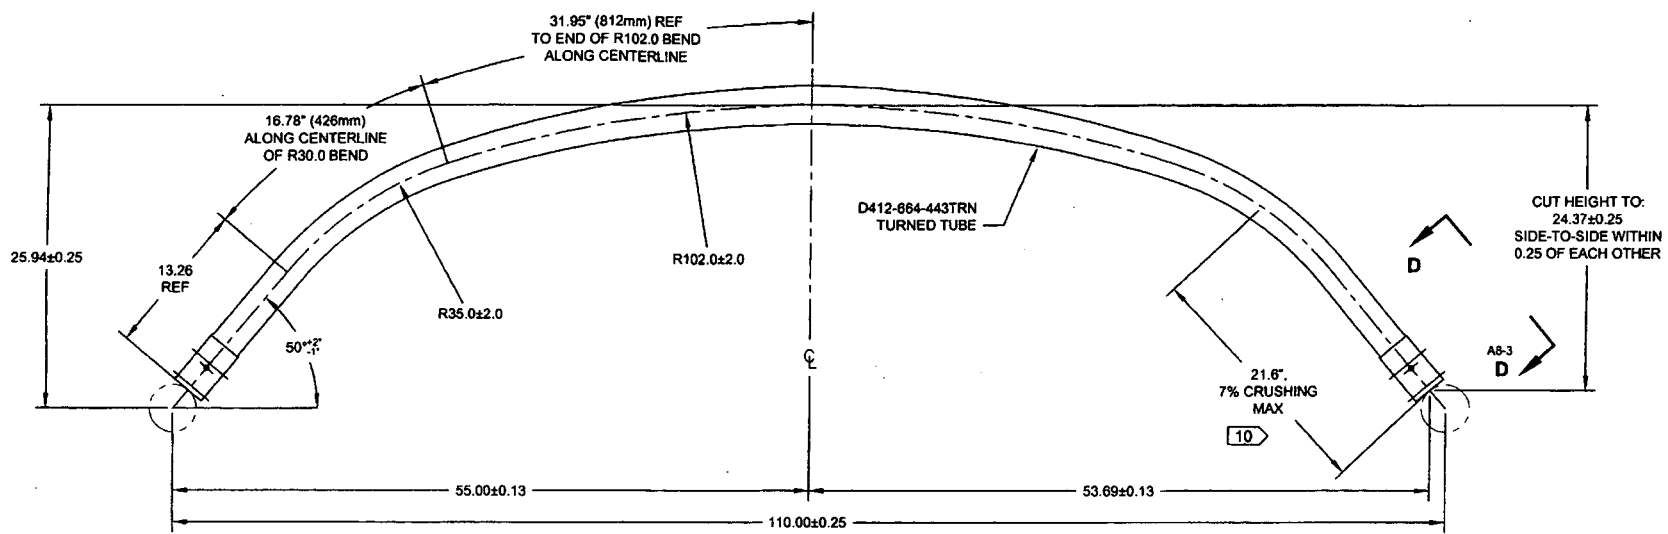

**D412-664-443BND**  
BENDING DETAIL


10

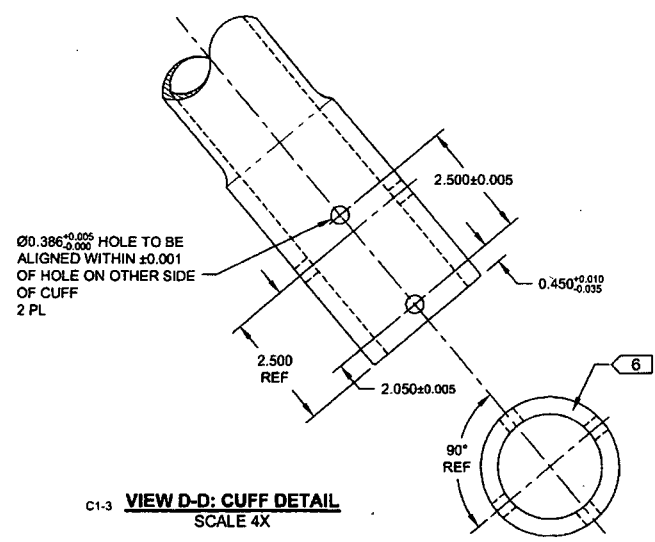


C1-3 **VIEW D-D: CUFF DETAIL**  
SCALE 4X

**RELEASED**  
2014-05-26  
NWD


DESIGN	92	<b>DART AEROSPACE LTD</b>	
DRAWN	92	HAWKESBURY, ONTARIO, CANADA	
CHECKED	DW	DRAWING NO.	REV. A
MFG. APPR.	AS	D412-664-443	SHEET 3 OF 4
APPROVED	AS	TITLE	SCALE
DE APPR.	AS	CROSSTUBE ASSY (412 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2013 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

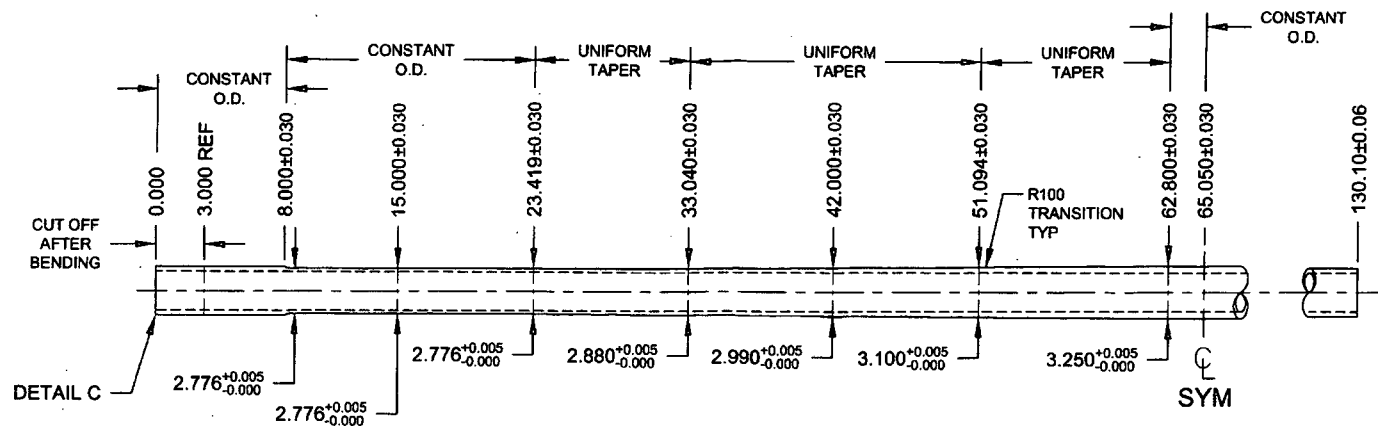

**D412-664-443TRN**  
**TURNING DETAIL**

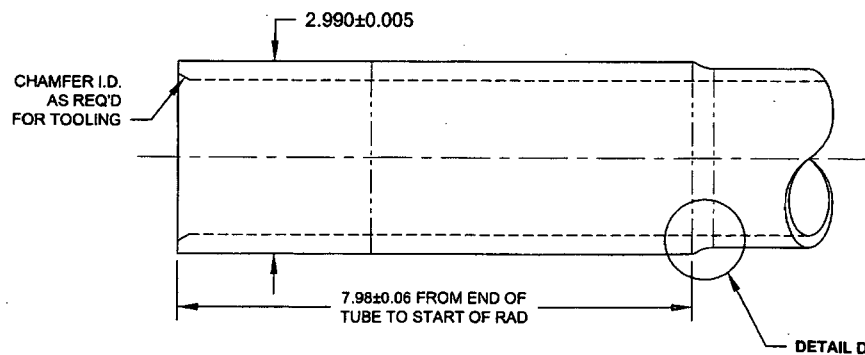

**DETAIL C:**  
**CUFF TRANSITION**  
SCALE 4X

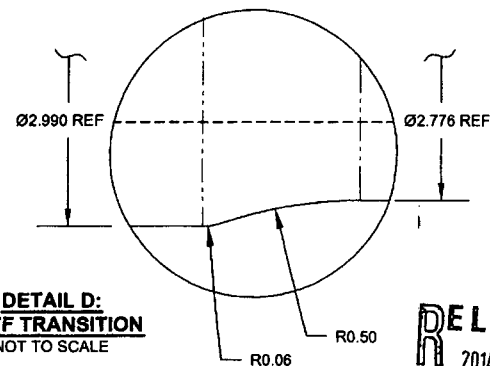

**DETAIL D:**  
**CUFF TRANSITION**  
NOT TO SCALE

**RELEASED**  
2014-05-26

DESIGN	97	<b>DART AEROSPACE LTD</b>	
DRAWN	97	HAWKESBURY, ONTARIO, CANADA	
CHECKED	DL	DRAWING NO.	REV. A
MFG. APPR.		D412-664-443	SHEET 4 OF 4
APPROVED		TITLE	SCALE
DE APPR.		CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2013 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR DISCLOSED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

**D412-664-403 Stainless Steel Hardened Crosstube**

**setup**

3.25" rollers

Bend lines are @ 32", 35" from centerline of tube

1.75" shims are used in the buggy for side bends

**Middle Bend**

Middle bend goes from 35" line with crosstube being on the large table of the machine.

Approach for middle bend is 2870 on both rollers. Run programs middle 1-6 check.

**Side Bends**

Run programs side 1-10 down the taper from 32" tangent line. Approach is 2900 on Y roller and 3385 on W roller. Programs 1-5 go back to the tangent line ready for next bend. Program 6-10 release at the end. Approaches on programs 6-10 are on the first line of programs... Programs 11-15 run down taper for 9" then come back up to finish tube slowly, be careful with these programs...

Enjoy

**Notes:**

13/12/12 ran 1 tube, program middle 6 was not enough, prog middle 7 overbent slightly. will create middle 6b to be a halfway point. after program 7 we ran the tube as per folio. one side finished nicely at program 10, the opposite side finished nicely after running program 1 2 times, then 13 to finish. this left the tube closer to max tolerance on the span, 53.730/53.800.

Handwritten calculations for three columns:


1	1	1
2	2	2
3	3	3
4	4	4
5	5	5
6	6	6
7	6b	7
8	7	8
9	7	9
10	7	10
11		11
12		12
13		13
14		14

Handwritten note: 3500W / 3250Y

14/6/24

1412-664-403

Comparison of bending strength of mid point of lower band with 8% crushing with cheffing shield location to determine which location is critical.

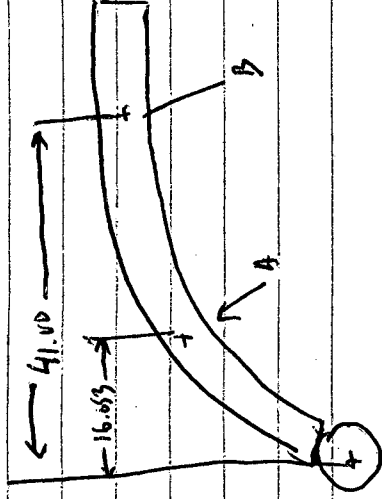

Point A:

$$OD = 2.789 \quad ID = 2.400$$

$$I = 1.172 \text{ in}^4 \quad c = 1.293 \text{ in} \quad (\text{with 8\% crushing, from AutoCAD})$$

Point B:

$$OD = 3.099 \quad ID = 2.410$$

$$I = 2.899 \text{ in}^4 \quad c = 1.550 \text{ in}$$

$$F = M_c / I$$

$$MS = F_B / F_A - 1 = \frac{P \cdot 41.00 \cdot 1.550}{2.899} \cdot \frac{1.172}{16.693} - 1 = 0.242$$

MARGIN IS POSITIVE,  $\therefore$  X-tube will fail at cheffing shield in bending before mid point of lower band with 8% crushing.  $\therefore$  8% crushing ~~at~~ in lower half of lower band is acceptable.

14/6/24

14/6/24

**Linda Lacelle**

---

**From:** Mike Petsche  
**Sent:** June-26-14 8:06 AM  
**To:** Linda Lacelle; Chris Provencal  
**Cc:** Nigel Forbes; Patrick Smith  
**Subject:** RE: SS regular height crosstubes

For the 412?

That requirement was probably a carry-over from the 350. No load test required

---

**From:** Linda Lacelle  
**Sent:** Thursday, June 26, 2014 7:58 AM  
**To:** Mike Petsche; Chris Provencal  
**Cc:** Nigel Forbes; Patrick Smith  
**Subject:** SS regular height crosstubes  
**Importance:** High

NDT will be here any minute...the w/o says to load test these...is this correct???? I see no mention of load testing on the drwg..  
Please let me know ASAP....

Thx  
Linda



Dart Aerospace Ltd.  
1270 Aberdeen Street  
Hawkesbury, ON K6A 1K7  
Tel: 613 632 9577  
Fax: 613 632 1053

## PURCHASE ORDER

Purchase Order ID **PO24765**

Purchase Order Date 6/26/2014

PO Print Date 6/26/2014

Page Number 1 of 3

**Order From :**

VC-SKY001

SKYSERVICE  
6120 MIDFIELD ROAD  
MISSISSAUGA, ONTARIO L5P 1B1  
CANADA

**Ship To :** DART AEROSPACE LTD

1270 ABERDEEN  
HAWKESBURY, ON K6A 1K7  
CANADA

**Contact Name**

**Vendor Phone** 905-678-5636

**Ship To Contact**

**Ship To Phone**

**Ship Via:** Delivered

**Ship Acct:**

**Buyer**

Chantal Lavoie

**Customer POID**

**Customer Tax #** 10127-2607

**Terms** Net 30

**Currency** CAD

**FOB** FCA - (Free Carrier)

Line Nbr	Reference Vendor Part Number	Description/ Mfg ID	Req Date/ Taxable	CD	Req Qty/ Unit of Measure	PO Unit Price	Extended Price
Line Comments		Promise Date					
Delivery Comments							

1	119872	D412-664-403 CROSSTUBE	6/26/2014		1.00	\$264.00	\$264.00
			Yes				
			6/26/2014				

LIQUID PENETRANT INSPECTION AS PER QSI 038 OR  
LPI AS PER ASTM 1417 LEVEL 2

**Line Total:** \$264.0

2	119870	D412-664-403 CROSSTUBE	6/26/2014		1.00	\$264.00	\$264.00
			Yes				
			6/26/2014				

LIQUID PENETRANT INSPECTION AS PER QSI 038 OR  
LPI AS PER ASTM 1417 LEVEL 2

**Line Total:** \$264.0

SP14-6-27

**Note:**

6/26/2014



# skyservice Work Order Traveler

Sky Service F.B.O. Inc.

Page: 1 of 1

DOT APP 53-89 / EASA 145.7142 / BDA AMO 385

WO #: MWO21293	Customer: Dart Aerospace Ltd.	Dept: NDT YUL	Reference: 24765
Descr:	PN:	S/N:	Qty: 1
Make:	Model:	Reg:	A/C S/N:
TSN: 0	CSN: 0	TSO: 0	
Task: UNSCHEDULED			Sequence: 1


## Work Required:

CARRY OUT NDT INSPECTION (LIQUID PENETRANT) ON 4 CROSSTUBES

ITEM ID: D412-664-403 CROSSTUBE, HEAVY DUTY, HIGH AFT, 412

- 1 - WORK ORDER ID#: 119870 ✓
- 2 - WORK ORDER ID#: 119872 ✓
- 3 - WORK ORDER ID#: 119871 ✓
- 4 - WORK ORDER ID#: 119869 ✓

80 14-6-27

Action Taken:						Date:	Initial/Stamp:
LIQUID PENETRANT INSPECTION CARRIED OUT ON ITEMS LISTED ABOVE (ITEMS 1-4) AS PER ASTM1417M-13						JUN 26 2014	 6
NO CRACK FOUND							
Pen: ZL-56 BATCH# 09H094 EXP. DATE: AUG 2014, DEV: SKD-S2 EXP. DATE: OCT2017 CLEANER: SKC-S EXP. DATE: APR 2018							
Description	Location	P/N	Qty	Batch	S/N Off	S/N On	

I certified that the maintenance described above has been performed in accordance with the applicable standard of airworthiness.

Signature:		ACA/SCA Stamp DOT-APP 177 53-89	Date:
Name:			ANTONINO MARCHETTA